

Department of Health & Human Services
Centers for Medicare & Medicaid Services

Printed: 08/27/2026
Form Approved OMB
No. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 235500	(X2) MULTIPLE CONSTRUCTION A. Building B. Wing	(X3) DATE SURVEY COMPLETED 06/25/2026
NAME OF PROVIDER OR SUPPLIER Omni Continuing Care		STREET ADDRESS, CITY, STATE, ZIP CODE 5201 Conner Detroit, MI 48213	
For information on the nursing home's plan to correct this deficiency, please contact the nursing home or the state survey agency.			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (Each deficiency must be preceded by full regulatory or LSC identifying information)		
F 0921 Level of Harm - Minimal harm or potential for actual harm Residents Affected - Many	Make sure that the nursing home area is safe, easy to use, clean and comfortable for residents, staff and the public. **NOTE- TERMS IN BRACKETS HAVE BEEN EDITED TO PROTECT CONFIDENTIALITY** Based on observation, interview, and record review, the facility failed to maintain general cleanliness and repair of the premises as well as proper storage of clean and sanitary supplies. This resulted in an increased potential for contamination and a possible decrease in satisfaction of living affecting all residents. Findings Include: On 06/23/2026 at 7:53 PM observed a janitor sink with a chemical pre-dispensing system in place and the cold water faucet on in the [NAME] Hall janitor closet. This set up puts undue back pressure on the faucet's Hose Bib vacuum breaker, which can compromise the integrity of the mechanism. On 06/23/2026 at 8:02 PM observed chipped paint on the toilet base and along the interior surface of the bowl in the [NAME] Hall shower room. [NAME] discoloration was visible on the interior of the bowl in areas where paint was missing. Caulking was missing around the base and showed brown discoloration in some areas. On 06/23/2026 at 8:03 PM observed an approximate one by one foot section of tile missing on the wall at the shower controls in the [NAME] Hall shower room. A wood slab and the water line were visible through the wall. Further observation in the adjacent shower stall found the shower head with paint peeling. On 06/23/2026 at 8:11 PM observed eight one by one inch floor tiles missing near the tub in the [NAME] Hall bathroom. On 06/23/2026 at 8:19 PM observed chipped paint on the toilet bowl interior surface and areas of brown discoloration where paint was missing. Hair was observed on the seat, around the rim, and in the bowl in the [NAME] Hall shower room. The caulking around the base of the toilet was observed missing in some areas. On 06/23/2026 at 8:26 PM observed a connecting piece missing on the shower control, leaving a space and the screw head protruding from the control in the Gratiot Hall shower room. Further observation found the toilet seat and internal bowl with areas of paint missing and brown spots consistent with corrosion. The shower bed mat was also observed to be creased throughout the entire surface with black residue spots present on the mat. On 06/23/2026 at 8:30 PM observed the ceiling light partially detached and hanging from the ceiling in the Gratiot Hall soiled utility room. On 06/23/2026 at 8:40 PM observed a hopper with the hot water release only as a trickle in the Gratiot Hall soiled utility room. On 06/23/2026 at 8:47 PM observed a trickle of water released from the tub hot water faucet in the Gratiot Hall bathroom. Black buildup was observed accumulated around the rim of the tub faucet. Further observation found the hand sink slow to drain. On 06/23/2026 at 9:00 PM observed chipped paint on the interior surface of the toilet bowl and brown discoloration on the inside of the bowl where paint was missing in the [NAME] Hall shower room. Hair and debris were around the surface of the toilet seat. On 06/23/2026 at 9:06 PM observed brown stained and bulging ceiling tiles with evidence of water damage in the [NAME] Hall ice machine room. On 06/23/2026 at 9:23 PM observed a bed sheet covering the top half of a portable clean linen cart in hall. On 06/24/2026 at 9:05 AM in an interview, Nursing Home Administrator (NHA) indicated there is no maintenance director currently and indicated they are serving as the maintenance director. On 06/24/2026 at 9:25 AM in an interview with Housekeeping and Laundry Supervisor (HLS) G, when asked about the portable laundry carts, HLS G indicated the carts are used for easy access. On 06/24/2026 at 9:28 AM in an interview regarding cleaning, HLS G indicated housekeeping cleans shower rooms and equipment two to three (continued on next page)		

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE	TITLE	(X6) DATE
--	-------	-----------

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 235500	(X2) MULTIPLE CONSTRUCTION A. Building B. Wing	(X3) DATE SURVEY COMPLETED 06/25/2026
NAME OF PROVIDER OR SUPPLIER Omni Continuing Care		STREET ADDRESS, CITY, STATE, ZIP CODE 5201 Conner Detroit, MI 48213	
For information on the nursing home's plan to correct this deficiency, please contact the nursing home or the state survey agency.			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (Each deficiency must be preceded by full regulatory or LSC identifying information)		
F 0921 Level of Harm - Minimal harm or potential for actual harm Residents Affected - Many	times a day. On 06/24/2026 at 9:35 AM observed the floorboard pulled away from the adjoining board and partially peeling with circular indentation marks in the Gratiot Hall day room. On 06/24/2026 at 9:39 AM observed a portable clean linen cart with the cover open in the Gratiot Hall exposing the linens inside. In an interview at this time, HLS G indicated it should be closed. On 06/24/2026 at 9:43 AM observed chipped paint on the interior surface of the toilet bowl and brown discoloration on the inside of the bowl where paint was missing in the [NAME] Hall shower room. In an interview at this time HLS G indicated staff clean the toilets and it looks like rust. On 06/24/2026 at 9:59 AM observed an accumulation of wood shavings in the utility sink basin along with a bucket in the [NAME] Hall soiled utility room. The other basin of the two compartment sink contained a bucket and had brown particulate matter floating in water at the bottom of the sink. In an interview with HLS G at this time when, asked what housekeeping cleans in the room, HLS G indicated they clean floors and take out trash. On 06/24/2026 at 10:10 AM observed a portable clean linen cart with two disposable cups filled with wrappers among the linen in the [NAME] Hall. On 06/24/2026 at 10:45 AM an interview was conducted with Maintenance Assistant (MA) J. When asked about the Maintenance director, MA J indicated the facility had been without a maintenance director for about three weeks to a month. On 06/24/2026 at 10:47 AM an interview was conducted with MA J. When asked about the hole in the shower room wall, MA J indicated they did know about it but cannot fix it and have to call someone to help. When asked about general repairs around the facility, MA J indicated there is an online service that requests can be uploaded. MA J indicated they do not have access and the NHA hands them requests. On 06/24/2026 at 11:01 AM observed a janitor sink with chemical pre-dispensing system in place and the water on in the maintenance office/storage room in the basement. This set up puts undue back pressure on the faucet's Atmospheric Vacuum Breaker, which can compromise the integrity of the mechanism. On 06/24/2026 at 3:41 PM observed the baseboard peeled away from the wall and black buildup present behind and around the baseboard in the area beneath the sink in resident room [ROOM NUMBER]. Further observation found raised and missing paint along the walls at the entrance of the room as well as the emergency pull cord box partially attached and not secure. On 06/24/2026 at 3:43 PM observed a portable clean linen cart with the cover open and facing out in the [NAME] Hall. Record review of the facility provided document titled Laundry Services last dated 8/26/2025, includes the proper storage of linen, Linen is stored in separate rooms, closets, or other designated spaces with a closing door or cover to assist in reducing the risk of accidental contamination.		